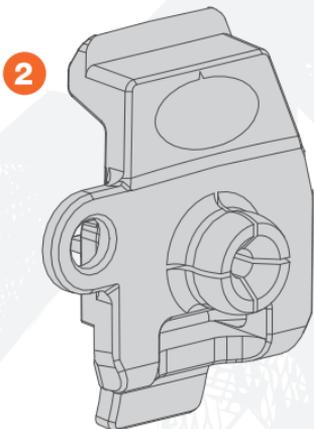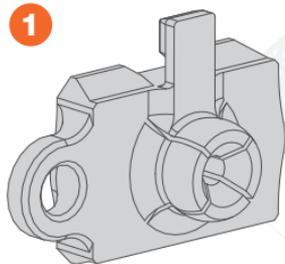# KNUCKL™
INSTALLATION INSTRUCTIONS

UNITY

⚠ WARNING: Over-torquing fasteners can damage your mount and will not be covered by warranty.

Select the appropriate adapter for the helmet rail. KNUCKL™ includes adapters for both Ops-Core ARC™ and Team Wendy EXFIL™ rails.

1 Slide ARC™ adapter into ARC™ rail to desired location. Detent tab will snap into recess above the rail.

2 Remove the accessory plate and screws from EXFIL™ rail. Tip EXFIL™ adapter into T-Slot and pivot down until it snaps securely in place in accessory plate recess.
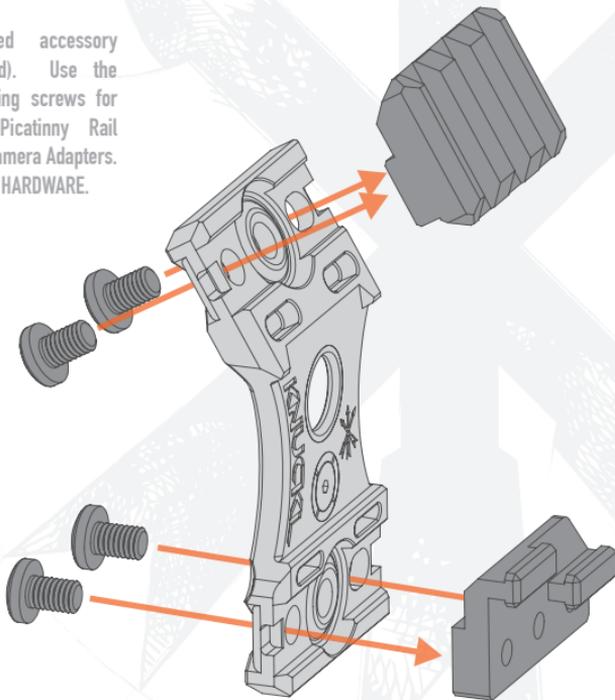
KNUCKL™
INSTALLATION INSTRUCTIONS

UNITY

3 Choose the desired accessory components (included). Use the included thread-forming screws for mounting polymer Picatinny Rail Section and Contour Camera Adapters. DO NOT OVER-TIGHTEN HARDWARE.
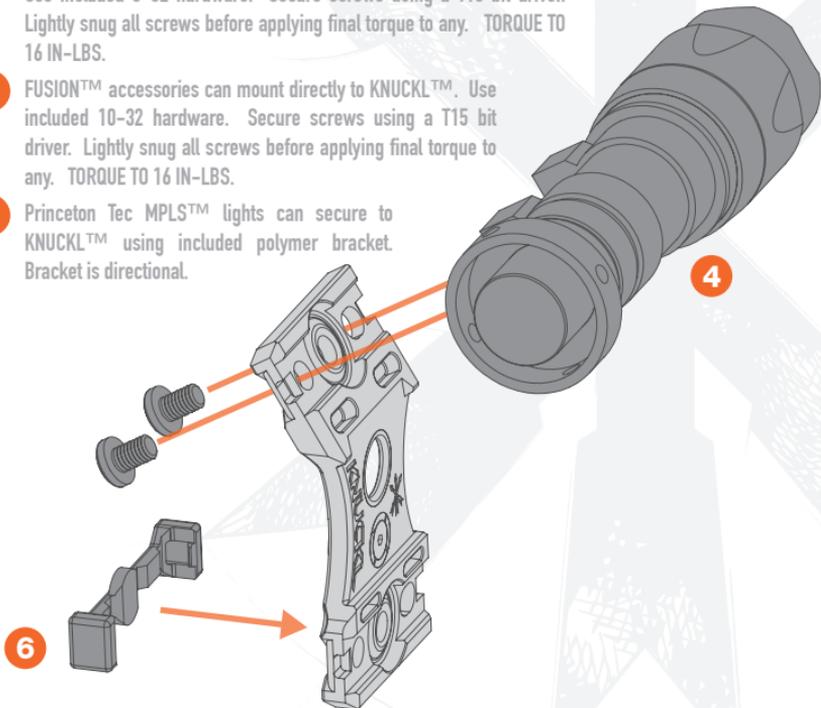
KNUCKL™
INSTALLATION INSTRUCTIONS

UNITY

4 Surefire SCOUT™ pattern footprints can mount directly to KNUCKL™. Use included 8–32 hardware. Secure screws using a T15 bit driver. Lightly snug all screws before applying final torque to any. TORQUE TO 16 IN–LBS.

5 FUSION™ accessories can mount directly to KNUCKL™. Use included 10–32 hardware. Secure screws using a T15 bit driver. Lightly snug all screws before applying final torque to any. TORQUE TO 16 IN–LBS.

6 Princeton Tec MPLS™ lights can secure to KNUCKL™ using included polymer bracket. Bracket is directional.

KNUCKL™
INSTALLATION INSTRUCTIONS

UN✟TY

⚠ **WARNING: Over-torquing fasteners can damage your mount and will not be covered by warranty.**

7 Press KNUCKL assembly onto the ball joint of the adapter installed on the helmet rail.

8 Thread tension screw into ball joint and tighten to desired tension.